

Technische Journaals

Referentienr.: SE 30992. 3. 0 en-GB

Statusdatum: 23-9-2016

Opgesteld door: -

Opsteldatum: 23-9-2016

Titel: S/V60 PHEV No start

Partner: 4 SE PVT PVT

Status: Released

Referentie:

Functiegroep: 3300 starting system

Bijlage:

Type auto

Type	Motor	Omschr. motor	Verkoop	Carrosserie	Transmissie type	Stuur	Modeljaar	Fabriek	Chassisnummers reeks	Reeks productieweek
138	BL	BASPHEV					2016-2017		0085109-0136672	201520-201637
155	AA	D82PHEV					2013-2015		0150063-0272187	201246-201516
155	BN	D87PHEV					2016-2016		0247053-0323781	201446-201613
155	DC	D97PHEV					2016-2016		0285096-0323781	201517-201613

CSC Klantsymptoomcodes

Code	Omschrijving
7B	Starting/Engine does not start/Engine does not turn/No clicking sound at start attempt
BE	Starting/Engine does not start/Engine does not turn/Unsure when/at all times
BJ	Starting/Engine does not start/Unsure when/at all times

DTC Storingscodes

Regeleenheid	Code	Omschrijving	Storingstype
IEM	U041268	Ongeldige data ontvangen van de noodregeleenheid accu (BECM). Op algoritme gebaseerde storingen. Evenementinformatie	
ECM	P0CE200	Regelcircuit regelklep "A" koelvloeistof accupakket hybride/EV laag. .	
ECM	P300111	Koelvloeistofklep #1 hybride/EV-elektronica. Algemene elektrische storingen. Kortsluiting naar massa	
ECM	P300211	Koelvloeistofklep #2 hybride/EV-elektronica. Algemene elektrische storingen. Kortsluiting naar massa	
ECM	P300311	Uitschakelklep AC. Algemene elektrische storingen. Kortsluiting naar massa	

Handelingen

Handeling Nr.	Beschrijving van handeling
36004-2	Software control module downloading.

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

Tekst

Description

*Vehicle type updated

*Title changed

*Recipients added

Not possible to start the car and a message "Checking electrical system try again in 60 seconds", please follow advice under SERVICE. When this occur it is not possible to start the car and the quiescent current will increase and drain the 12 volt battery.

This state is permanent until the 12 volts battery has been disconnected and connected.

Service

Disconnect and connect the battery and check if the car starts again.

Perform DCDC SW upgrade.

Vehicle Report

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect or if the vehicle is outside the chassis number range. Use concern area "Vehicle Report" and sub concern area "Support Needed" use function group 3300.